

July 10, 2025

VIA ELECTRONIC MAIL

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: Envirosafe Services of Ohio, Inc.
 EPA Identification Number: OHD 045 243 706
 June 2025 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning June 1, 2025 and ending June 30, 2025.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Leachate system maintenance included:

- Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
- RW-3: Replaced faulty transducer - pulled stuck pump and untangled discharge line - pumped down within interval - force main found damaged - replaced damaged section with new coupler;
- PZ-13: Pump stuck in well and inoperable - assessing replacement;
- DPW-18: Above hi point - moved pump up and down in well, exercised valves - began pumping down;
- DPW-19: Displaying negative level – tightened transducer connections - level began reading correctly and within pumping interval;
- DPW-21R: replaced dim display panel and reprogrammed pump levels;
- DPW-22: Transducer unresponsive – replacement scheduled;
- NRP-27: Level reading low - pulled and cleaned transducer (clogged) level reading just below pumping interval;
- NRP-29: Above hi point - cleaned pump starter connections - pump starter replacement scheduled;
- NRP-32: Not pumping - pulled and cleaned pump - began pumping with significant discharge;

Mr. Michael Terpinski

July 10, 2025

Page 2

- SWMU 6 Compressor: emptied condensation bucket – compressor and attic fan observed to be functioning as designed;
2. NAPL Recovery System – NAPL levels observed as 6” to not present – MR-6S absorbent sock slipped into well and was replaced – all other absorbent socks observed with available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

1. RW-1 – replace test valve on 7/2;
2. PZ-13 – Replacement of damaged riser, discharge line and pump if needed – active as piezometer;
3. DPW-22 – Replacement of transducer – not urgent or impacting TLL;
4. NRP-29 – Replacement of pump starter; and
5. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact me at (224) 723-8215.

Sincerely,



Stephen J. DeLussa

Corporate Director – TSDF Compliance

ec: Franklin Irelan, ESOI
Audrey Jones, ESOI
Dawn Pleiman, Ohio EPA-NWDO, DERR
Michael Momenee, The Mannik & Smith Group

Kristofer Mann, ESOI
Gary Deutschman, Ohio EPA-NWDO, DERR
Mark Nielsen, BBJ Group