

October 7, 2025

VIA ELECTRONIC MAIL

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

 
**Re: Envirosafe Services of Ohio, Inc.
 EPA Identification Number: OHD 045 243 706
 September 2025 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning September 1, 2025 and ending September 30, 2025.

Corrective Measures Implementation ("CMI"):

Project Activities:



During this reporting period, CMI activities included the following:

1. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - PZ-13: Pump stuck in well and inoperable – assessing replacement;
 - DPW-22: Transducer unresponsive – replacement has been scheduled;
 - NRP-26: Above hi point – pump starter scheduled for replacement;
 - NRP-29: Above hi point – pump starter scheduled for replacement;
 - NRP-31: Transducer was reading incorrectly – repaired loose wire on transducer and verified working;
 - NRP-30: Displayed negative level – tightened loose wire inside control panel and began reading correctly;
 - NRP-34 Replaced dim control panel display;
 - SWMU 6 Compressor: Compressor over-pressurizing – replaced faulty solenoid – compressor continues over-pressurizing – will evaluate pressure switch next – emptied condensation bucket – compressor and attic fan observed to be functioning as designed;
 - SWMU 7: Reset main breakers and individual well breakers – no change;
2. NAPL Recovery System – NAPL levels observed as skim to not present, absorbent sock at well T-205(5) replaced, others observed with available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

1. PZ-13 – Replacement of damaged riser, discharge line and pump if needed – active as piezometer;
2. DPW-22 – Replacement of transducer – not urgent or impacting TLL;
3. NRP-26 & NRP-29 – Replacement of pump starter;
4. SWMU-6 compressor – Repair or replace pressure switch;
5. SWMU-7 – Evaluate electrical issues; and
6. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Audrey Jones at (419) 343-6187.

Sincerely,



Franklin Ireland
General Manager

cc: Franklin Ireland, ESOI
Audrey Jones, ESOI
Dawn Pleiman, Ohio EPA-NWDO, DERR
Michael Momenee, The Mannik & Smith Group

Stephen DeLussa, CC
Gary Deutschman, Ohio EPA-NWDO, DERR
Mark Nielsen, BBJ Group