

876 Otter Creek Road Oregon, Ohio 43616-3518 Phone: (419) 698-3500 Fax (419) 698-8663

Website: www.crystal-clean.com

November 12, 2025

VIA ELECTRONIC MAIL

Mr. Michael Terpinski Ohio EPA, NWDO, DERR 347 North Dunbridge Road Bowling Green, OH 43402

Re: Envirosafe Services of Ohio, Inc.

EPA Identification Number: OHD 045 243 706

October 2025 Progress Report

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning October 1, 2025 and ending October 31, 2025.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

- 1. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - RW-11: Placed fill in animal burrows near area;
 - DPW-21R: Relabeled well;
 - PZ-13: Pump stuck in well and inoperable assessing replacement;
 - DPW-22: Transducer intermittently unresponsive evaluating replacement;
 - DPW-23: Relabeled well;
 - NRP-26: Above hi point pump starter replacement scheduled;
 - NRP-31: Transducer was reading negative level cleaned the transducer and now reading within normal pumping interval:
 - NRP-32: Placed fill in animal burrows near area
 - SWMU 6 Compressor: Pressure gauge faulty replaced pressure gauge and restarted verified gauge and pressure cutoff are working – emptied condensation bucket – compressor and attic fan observed to be functioning as designed;
 - SWMU 7: Intermittently down due to faulty storage tank level indicator manual level monitoring being used - replacement indicator ordered and expected in November;

2. NAPL Recovery System – NAPL levels observed as skim to not present, absorbent sock at well T-205(5) replaced, others observed with available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

- 1. PZ-13 Replacement of damaged riser, discharge line and pump if needed active as piezometer;
- 2. DPW-22 Replacement of transducer not urgent or impacting TLL;
- 3. NRP-26 & NRP-29 Replacement of pump starters;
- 4. SWMU-6 compressor Repair or replace pressure switch;
- 5. SWMU-7 Evaluate electrical issues; and
- 6. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Audrey Jones at (419) 343-6187.

Sincerely,

Franklin Irelan General Manager

ec: Franklin Irelan, ESOI Audrey Jones, ESOI

> Dawn Pleiman, Ohio EPA-NWDO, DERR Michael Momenee, The Mannik & Smith Group

Stephen DeLussa, CC Gary Deutschman, Ohio EPA-NWDO, DERR Mark Nielsen, BBJ Group