

March 12, 2026

VIA ELECTRONIC MAIL

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: EnviroSAFE Services of Ohio, Inc.
EPA Identification Number: OHD 045 243 706
February 2026 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), EnviroSAFE Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning February 1, 2026 and ending February 28, 2026.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - Measured liquid level at each location with an interface probe;
 - NRP-24: Observed above the hi point – flushed valve train (clogged with silt) and began pumping down;
 - NRP-25, NRP-27, NRP-28: Reset circuit breakers inside control panels;
 - RW-1 & NRP-32: Discharge and air lines observed to be intact;
 - SWMU 6 Compressor: Started compressor and verified auto-drains function- emptied condensation bucket- compressor attic fan observed to be off;
2. Collection of semi-annual leachate system elevation measurements on February 26, 2026 prior to restart of operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7. An inward gradient continues to be maintained. Each unit average interior leachate levels was below the lowest exterior groundwater elevation. However, notice is hereby being provided that the following wells did not demonstrate the performance standard: maintenance of the leachate head level

measurement below a gradient based TLL of 3.0 feet below the lowest groundwater elevation in the relevant shallow perimeter monitoring well(s).

NRP-34: 2.8 feet below the lowest groundwater elevation

NRP-35: 2.4 feet below the lowest groundwater elevation

As in previous years, reactivation of all pumps is expected to quickly lower the leachate elevation and achieve the TLL. However, an electrical issue at SWMU 7 will delay full activation of the system. The tank level sensor may be preventing the field system from coming online and is actively being evaluated for repair. Upon repair, the leachate elevation is expected to quickly achieve the TLL.

In accordance with the OMPM Plan, the elevation in this well will be monitored quarterly until the excursion has been eliminated. Response actions such as those listed in Section 6.5 are being taken.

3. NAPL Recovery System – NAPL levels observed as skim to not present, absorbent socks observed to have available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

1. Repair electrical malfunction at SWMU-7;
2. Change oil in SWMU-6 compressor;
3. Replacement of pump starters for NRP-26 and NRP-29;
4. PZ-13 – Replacement of damaged riser, discharge line and pump if needed – active as piezometer;
5. Continue maintenance of leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Audrey Jones at (419) 343-6187.

Mr. Michael Terpinski

March 12, 2026

Page 3

Sincerely,



Franklin Irelan
General Manager

ec: Franklin Irelan, ESOI
Audrey Jones, ESOI
Dawn Pleiman, Ohio EPA-NWDO, DERR
Michael Momenee, The Mannik & Smith Group

Stephen DeLussa, CC
Gary Deutschman, Ohio EPA-NWDO, DERR
Mark Nielsen, BBJ Group