

April 10, 2026

**VIA ELECTRONIC MAIL**

Mr. Michael Terpinski  
Ohio EPA, NWDO, DERR  
347 North Dunbridge Road  
Bowling Green, OH 43402

**Re:    Envirosafe Services of Ohio, Inc.  
      EPA Identification Number: OHD 045 243 706  
      March 2026 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning March 1, 2026 and ending March 31, 2026.

**Corrective Measures Implementation ("CMI"):**

**Project Activities:**

During this reporting period, CMI activities included the following:

1. Leachate system maintenance included:
  - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
    - Recorded liquid level at each location with a control panel;
    - Verified functionality of all pumps without a control panel;
  - RW-2 – Animal burrows around pad – scheduled to be filled in April;
  - DPW-22: Observed above hi point - reset breakers - checked wiring - worked pump up and down – repaired kink in discharge hose – now cycling within interval;
  - NRP-24 – Observed below low point – verified no breakers tripped – cleaned pump starter – additional evaluation scheduled;
  - NRP-26: Observed above hi point - pump starter replacement scheduled;
  - NRP-29 – No power to control panel observed – scheduled for electrical evaluation;
  - NRP-35 – Displayed negative level – removed damaged section of transducer line – now functioning normally;
  - SWMU-6 compressor: Emptied condensation bucket - Compressor attic fan observed to be functioning as designed;
  - SWMU 7: Intermittently shut down due to electrical issues – manual level monitoring was being used – power restored by site electrical contractor and is now functioning properly and showing level measurements; and

Mr. Michael Terpinski

April 10, 2026

Page 2

2. NAPL Recovery System – NAPL levels observed as skim to not present, replaced absorbent socks at wells T-20S(2) and T-20S(6), others observed to have available capacity.

**Summary of All CMI-Related Contacts with the Public:**

ESOI has not had any related contacts with the public during this reporting period.

**Summary of Potential or Encountered Problems and Rectification Actions:**

There is nothing to report in association with this topic for this reporting period.

**Projected Work:**

During the next reporting period it is anticipated that the following activities will occur:

1. Assess SWMU-7 tank level indicator;
2. Change oil in SWMU-6 compressor;
3. NRP-24 – Additional pumping level evaluation;
4. NRP-26 and NRP-29 – Replacement of pump starters;
5. NRP-29 – Evaluate electric issue at control panel;
6. Identified animal burrows scheduled to be filled;
7. PZ-13 – Replacement of damaged riser, discharge line and pump if needed – active as piezometer;
8. Continue maintenance of leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Audrey Jones at (419) 343-6187.

Sincerely,



Franklin Irelan  
General Manager

ec: Franklin Irelan, ESOI  
Audrey Jones, ESOI  
Dawn Pleiman, Ohio EPA-NWDO, DERR  
Michael Momenee, The Mannik & Smith Group

Stephen DeLussa, CC  
Gary Deutschman, Ohio EPA-NWDO, DERR  
Mark Nielsen, BBJ Group