

September 10, 2026

VIA ELECTRONIC MAIL

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: Envirosafe Services of Ohio, Inc.
 EPA Identification Number: OHD 045 243 706
 August 2026 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning August 1, 2026 and ending August 31, 2026.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Leachate system maintenance included:

- Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
- DPW-18 – Observed to be above hi point – repaired kink in discharge line – observed to be pumping within interval;
- NRP-24 – Observed to be above hi point – verified transducer working – worked pump up and down – observed to be pumping normally;
- NRP-25 – Observed to be above hi point – verified pump starter engaged – cleaned transducer – added surfactants to loosen sludge in well – to continue to evaluate;
- NRP-26 – Observed to be above hi point – under electrical evaluation;
- NRP-29 – Observed to be above hi point – repaired by site electrical contractor and observed to be pumping normally;
- NRP-30 – Observed to be above hi point – reset tripped breaker – tightened loose transducer wire – observed to be pumping normally;
- SWMU-6 compressor: Emptied condensation bucket – compressor and attic fan observed to be functioning as designed;

2. NAPL Recovery System – NAPL levels observed as skim to not present, absorbent socks observed to have available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:


During the next reporting period it is anticipated that the following activities will occur:

1. NRP-25 – Continue to evaluate issues and repair if required;
2. NRP-26 – Verify that repair has been completed by site electrical contractor – continue manual pumping if needed;
3. NRP-33 – Evaluate force main shut off valve for repair as preventative maintenance – functioning normally;
4. PZ-13 – Replacement of damaged riser, discharge line and pump if needed – active as piezometer;
5. Replace red light indicator bulb for SWMU-6 tank.
6. Continue to complete annual yield tests on SWMU units.
7. Continue maintenance of leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Audrey Jones at (419) 343-6187.

Sincerely,

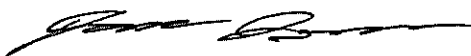

Franklin Ireland
General Manager

ec: Franklin Ireland, ESOI
Audrey Jones, ESOI
Dawn Pleiman, Ohio EPA-NWDO, DERR
Michael Momenee, The Mannik & Smith Group

Stephen DeLussa, CC
Gary Deutschman, Ohio EPA-NWDO, DERR
Mark Nielsen, BBJ Group